

Work Order ID 162811

Wednesday, June 14, 2017 11:32:01 AM

162811

Page 1

Item ID: D407-667-205TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 6/14/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/20/2017 Req'd Qty: 1.00

1

Customer:

Reference:

DAS
21Approvals: Process Plan: 9-89 Date: JUN 14 2017

Cooling:

Date:

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D407-667-245	Rev G

100

0.78

100

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

2.64

Mori Seiki CNC Lathe Large

1- Fill tube with sand & install plugs 407-205 on both ends as per Folio FA248

2- Face both side of tube

3- Turn first taper section on both side as per folio FA248

4- Blend transition lines only with belt sander 60 grit **Do not sand whole tube**

FOLIO REV: 1A
DWG REV: 6DAS
23
9-89

1 0

17/6/21

110

QC2- Inspect parts off machine FAI/FAIB

0.00

110

QC

Memo

0.00

Quality Control

DAS
23
9-89

1 0

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 162811

Wednesday, June 14, 2017 11:32:01 AM

162811

Page 2

Item ID: D407-667-205TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 6/14/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/20/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

120

Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

2.56

Mori Seiki CNC Lathe Large

1- Turn second taper on both side

2- Blend transition lines only with belte sander 60 grit, **Do not sand whole tube**:

**Do not use sandpaper coarser than 320 grit.

FOLIO REV: AADWG REV: G

3- Remove sand and plugs

4- Scribe part # and batch # using vibrating stylus on the cuff as per Dwg D407-667-245

1ØDAS
23
9-89

17/6/26

130

QC2- Inspect parts off machine FAI/FAIB

0.00

130

QC

Quality Control

Memo

0.00

Ultra sound the crosstube as per FAI. "wall thickness mesurment" at given location.

1ØDAS
23
9-89

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 162811

Wednesday, June 14, 2017 11:32:01 AM

162811

Page 3

Item ID: D407-667-205TRN**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Item Name:** Crosstube Turning Detail**Stop *NS2*****Start Date:** 6/14/2017 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 6/20/2017 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
140									
QC	Memo	0.02							
Quality Control									
145		0.06							
145									
Crosstubes	Memo	0.54							
Crosstubes	Grind off circumferential machining marks longitudinally.								
150		0.00							
150									
HandFXtube	Memo	1.27							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 162811

Wednesday, June 14, 2017 11:32:01 AM

162811

Page 4

Item ID: D407-667-205TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 6/14/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/20/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC7-Inspect Chemical Conversion Coat	0.00							
160									
QC	Memo	0.01							
Quality Control									
170	Packaging	0.00							
170									
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rackLocation: <u>LG14</u>								
180	QC21- Final Inspection - Work Order Release	0.00							
180									
QC	Memo	0.10							
Quality Control									



JUL 04 2017

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					

Picklist Print

Monday, June 19, 2017 8:54:57 AM

Page 1

Work Order ID: 162811

162811

Parent Item: D407-667-205TRN

D407-667-205TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 6/14/2017

Required Date: 6/20/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 Removed polish EC verified by: DD
IPP Rev:C 08-08-19 revE as per dwg DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D6011-115

Manufactured

No

120

Each

58.0000

1

1

D6011-115

Crosstube Material

Location

Loc Qty

Loc Code

BACK HALL

19

139419

19

LG003

39

107880

11

123976

19

144447

9

DAS
23
8-89

11/26/26

DART AEROSPACE LTD	Work Order: 162811
Description: Crosstube Assembly	Part Number: D407-667-245
Inspection Dwg: D407-667-245 Rev: G	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.492	✓		Vernier Caliper RG Vernier Caliper	
	1.832	+0.005/-0.000	1.834	✓			
	1.838	+0.005/-0.000	1.842	✓			
	1.892	+0.005/-0.000	1.897	✓			
	2.052	+0.005/-0.000	2.053	✓			
	2.206	+0.005/-0.000	2.211	✓			
	2.521	+0.005/-0.000	2.524	✓			
	2.633	+0.005/-0.000	2.634	✓			
	4.10	+/-0.030	4.10	✓			
	4.978	+/-0.030					
	2.040	+0.000/-0.010	2.031	✓			
	0.125	+/-0.010	0.125	✓			
	R0.063	+/-0.010	R0.063	✓			
	R0.500	+/-0.010	R.500	✓			
	112.91	+/-0.020	112.93	✓			
SIDE B	2.490	+0.005/-0.000	2.492	✓		Vernier Caliper RG Vernier Caliper	
	1.832	+0.005/-0.000	1.834	✓			
	1.838	+0.005/-0.000	1.842	✓			
	1.892	+0.005/-0.000	1.897	✓			
	2.052	+0.005/-0.000	2.053	✓			
	2.206	+0.005/-0.000	2.211	✓			
	2.521	+0.005/-0.000	2.524	✓			
	2.633	+0.005/-0.000	2.634	✓			
	4.10	+/-0.030	4.10	✓			
	4.978	+/-0.030					
	2.040	+0.000/-0.010	2.031	✓			
	0.125	+/-0.010	0.125	✓			
	R0.063	+/-0.010	R0.063	✓			
	R0.500	+/-0.010	R.500	✓			
	112.91	+/-0.020	112.93	✓			

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE




QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

DART AEROSPACE LTD		Work Order:	162811
Description: Crosstube Assembly		Part Number:	D407-667-245
Inspection Dwg: D407-667-245 Rev: G		Page 2 of 2	

WALL THICKNESS MEASUREMENT

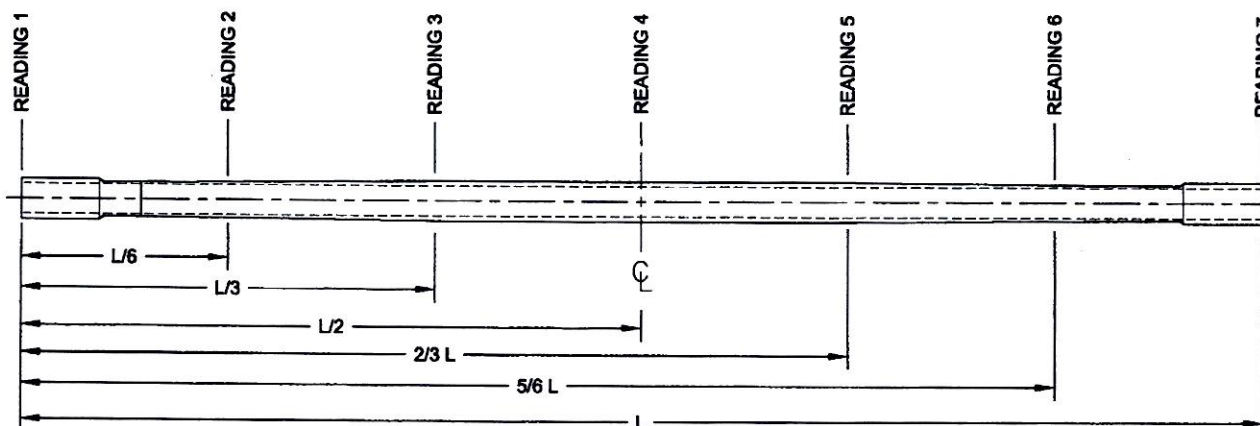

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	236	239	239	238	0.003	0.075"
READING 2 L= 18.82	226	241	261	252	0.035	
READING 3 L= 37.64	399	416	429	418	0.030	
READING 4 L= 56.46	644	650	659	657	0.015	
READING 5 L= 75.28	396	423	427	405	0.031	
READING 6 L= 94.10	217	251	269	238	0.052	
READING 7 L= 112.91	237	238	239	237	0.002	

Calibration Result

Actual Block Thickness: ~~900-750~~

Sitescan 250 Measured Thickness: ~~200-750~~

Measured by:	DAS 23 9-89	Audited by:	DAS 47 9-89	Preliminary Approval:	
Date:	18/6/26	Date:	17-06-27	Date:	

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	
F	12.06.04	Wall thickness form added	KJ	
G	15.05.14	Dwg Rev updated	KJ	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐			

Item	QTY	PART NUMBER	DESCRIPTION
	-245		
	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
1	1	D6011-115	CROSSTUBE
2	2	D2873-043	NUT PLATE
3	2	D2873-045	NUT PLATE
4	1	D2894-1	SUPPORT
5	2	D3190-1	CHAFING SHIELD
6	2	D3595-063-430	RUBBER CUSHION
7	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
8	4	MS21920-22	CLAMP
9	2	MS21920-25	CLAMP (OR MS21920-24)
10	AR	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
11	AR	PROSEAL 890	SEALANT

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT CROSSTUBE PER DART QSI 005 4.2
FOR HATCHED AREAS (ZN A6-2), MASK AS REQUIRED
TO APPLY PRIME AND APPLY CLEAR COAT ONLY
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: 27.7 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1 CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEAL D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS 50 TO 70 DEGREES FROM BOTTOM OF CROSSTUBE OPPOSITE D2894-1 SUPPORT.
- TORQUE CLAMPS 80 TO 100 IN-LB. TORQUE CLAMPS ON D3190-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. 162811 MJS
1706-14

RELEASED

2015 APR 09

ECN 15-557

G	INCCORP. DEO'S D407-667-245-F1/F2 (ZN D8-1, A8-1, D5-2, B6-2, C8-2); 8.90 WAS 8.53 (ZN D5-2); TORQUE REDUCED FOR CHAFING SHIELD (ZN A8-1); FINISH REVISED TO ALLOW MANUFAC. FLEXIBILITY (ZN C8-1)	RF	15.03.20
F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C8-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECN#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	RF	DRAWING NO.	REV. G
MFG. APPR.	RF	D407-667-245	SHEET 1 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____


WORK ORDER NON-CONFORMANCE / UPDATE




QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
☐ OTHER : _____					

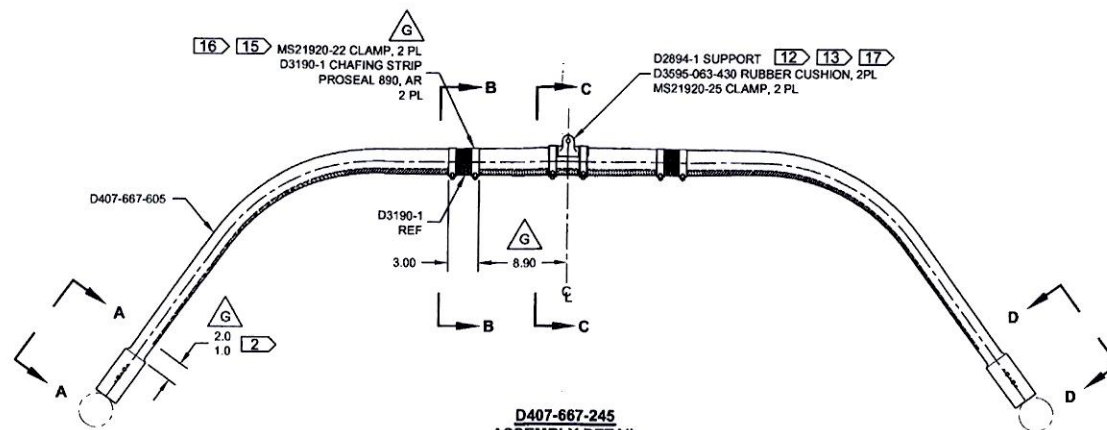


D407-667-245
ASSEMBLY DETAIL
(VIEW LOOKING FWD)

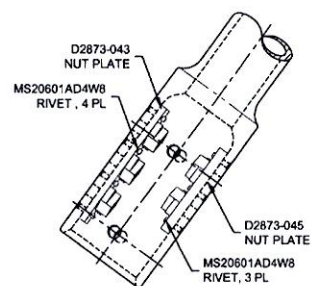


VIEW A-A CUFF DETAIL
SCALE 4X

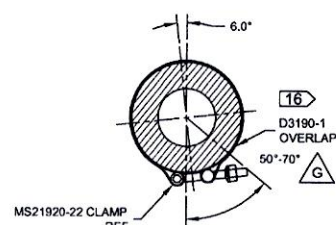


SECTION B-B
SCALE 4X, 2PL

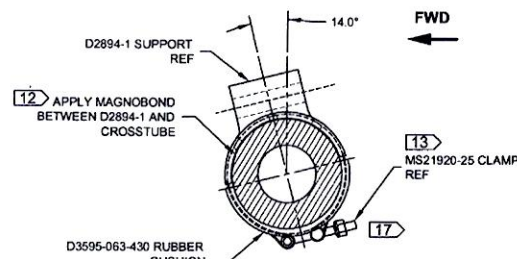

SECTION C-C
SCALE 4X

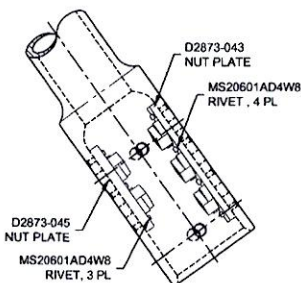

VIEW D-D CUFF DETAIL
SCALE 4X

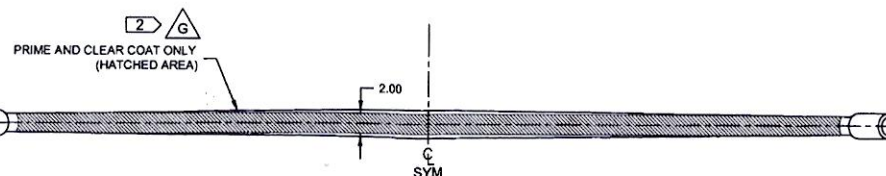

RELEASED
2015 APR 09

DESIGN	4P	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	4P	DRAWING NO.	REV. G
MFG. APPR.	4P	D407-667-245	SHEET 2 OF 4
APPROVED	4P	TITLE	SCALE
DE APPR.	4P	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					

8

7

6

5

4

3

2

1

D

C

B


A

D


C

B


A

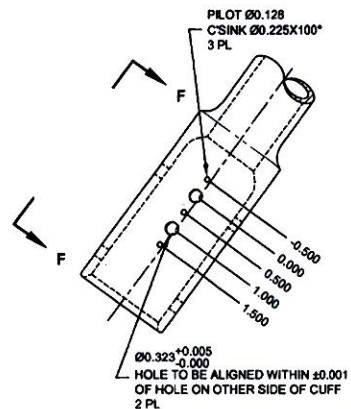


DETAIL E
SCALE 4X
(VIEW LOOKING FWD)

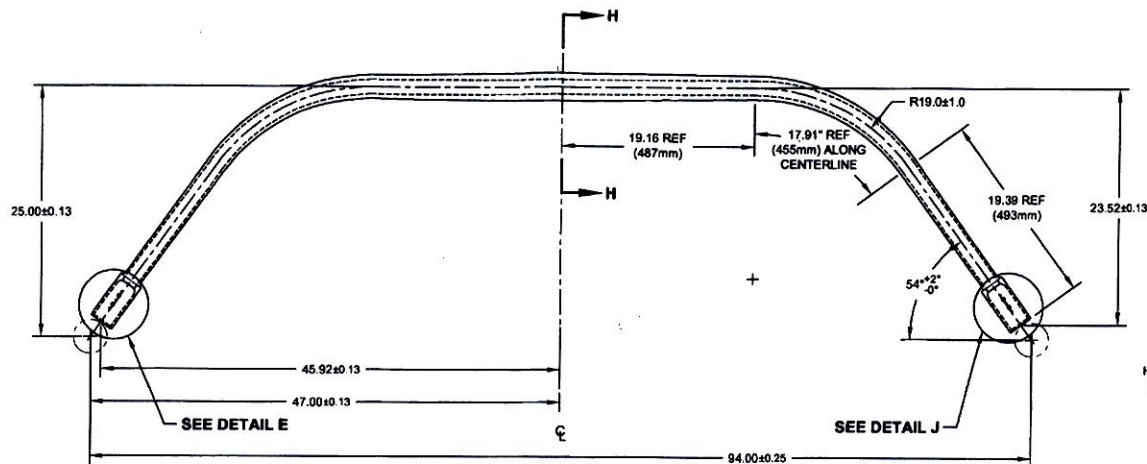


D407-667-605
BENDING AND DRILLING DETAIL
(VIEW LOOKING FWD)

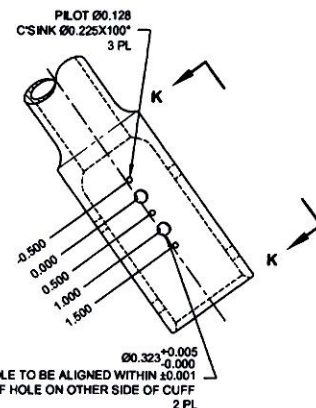


DETAIL J
SCALE 4X
(VIEW LOOKING FWD)

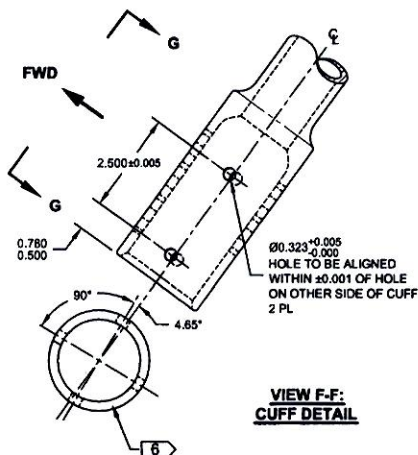


VIEW F-F:
CUFF DETAIL

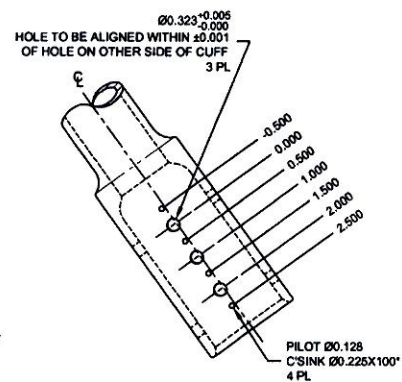


VIEW G-G
(VIEW LOOKING AFT, ROTATED)

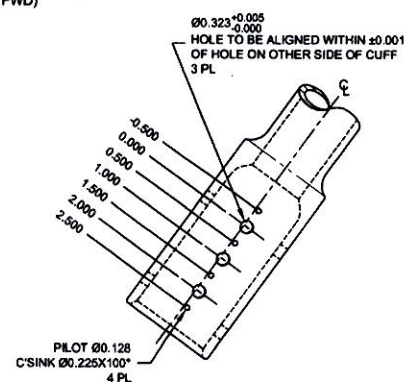

VIEW L-L
(VIEW LOOKING AFT, ROTATED)

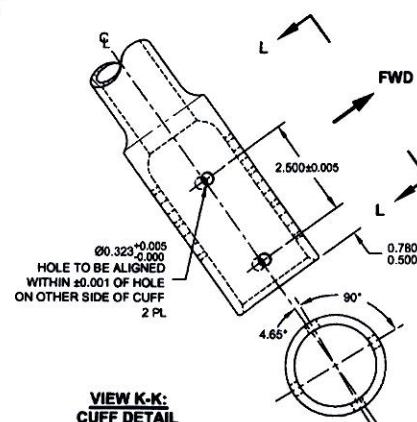

VIEW K-K:
CUFF DETAIL

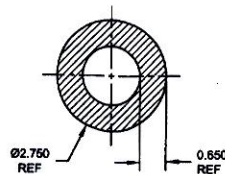

SECTION H-H
SCALE 4X

RELEASED

2015 APR 09

DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. G
MFG. APPR.	RF	D407-667-245	SHEET 3 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE




QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
☐ OTHER : _____					


SEE DETAIL M

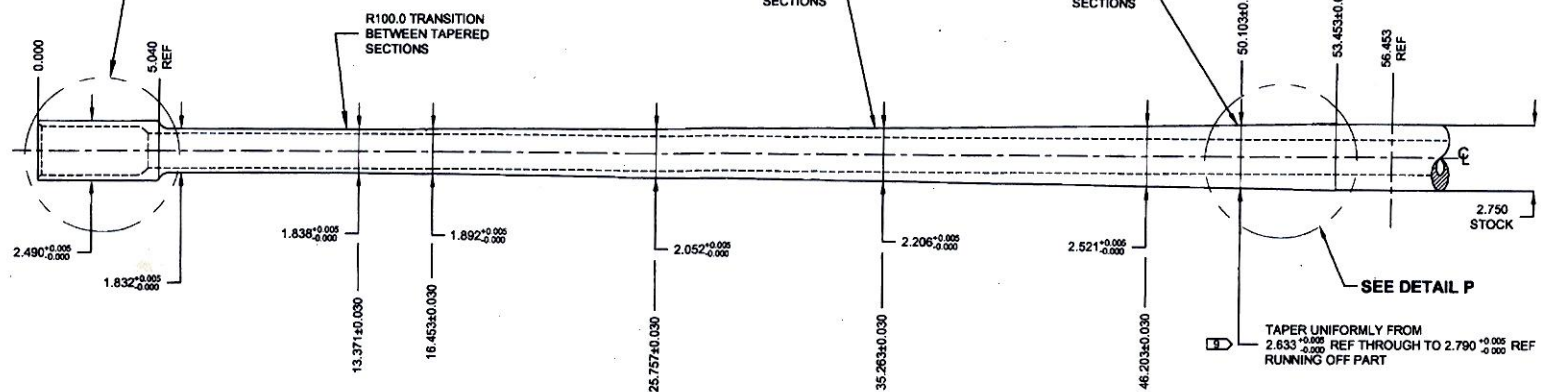


D407-667-245 MACHINING DETAIL

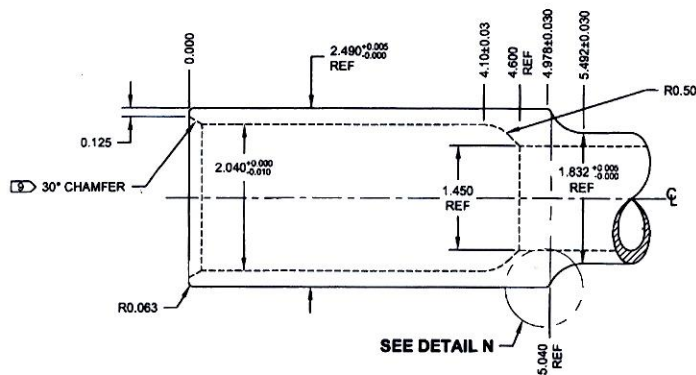

DETAIL M: CROSSTUBE CUFF
SCALE 3X

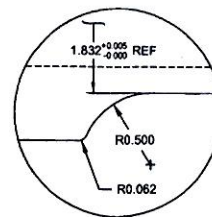

DETAIL N: CUFF TRANSITION
SCALE 2X

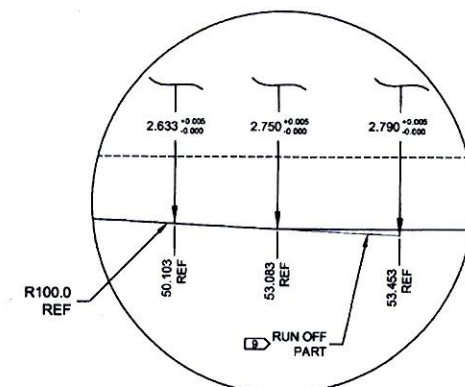

DETAIL P: TAPER RUN-OFF
NOT TO SCALE

RELEASED
2015 APR 09

DESIGN	QP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	QP	DRAWING NO.	REV. G
MFG. APPR.	RF	D407-667-245	SHEET 4 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	15.03.20	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					